



Software Release Notes

OneAdvisor 800A Wireless

Radio Analysis Module

Table of Contents

General Information	6
About this Document	6
Installation Instructions	6
Release 4.2.1-r0_a1	8
Software and Hardware compatibility	8
Bug Fix	8
Release 4.2.0-r0_a1	8
Software and Hardware compatibility	8
What's new in this release.	8
Improvement.....	9
Bug Fix	9
Known Issues	9
Release 4.1.2-r0_a2	10
Software and Hardware compatibility	10
What's new in this release.	10
Improvement.....	10
Bug Fix	10
Known Issues	10
Previous Version History	11
Release 4.1.2-r0_a1	11
Software and Hardware compatibility	11
What's new in this release.	11
Improvement.....	11
Bug Fix	11
Known Issues	11



Release 4.1.0-r0_a2	11
Software and Hardware compatibility	11
What's new in this release	12
Improvement	12
Bug Fix	13
Known Issues	13
Release 4.0.2-r0_a3	13
Software and Hardware compatibility	13
What's new in this release	13
Improvement	13
Bug Fix	13
Known Issues	13
Release 4.0.2-r0_a1	13
Software and Hardware compatibility	14
What's new in this release	14
Improvement	14
Bug Fix	14
Known Issues	14
Release 4.0.1-r0_a1	14
Software and Hardware compatibility	14
What's new in this release	15
Improvement	15
Bug Fix	15
Known Issues	15
Release 4.0.0-r0_a1	15
Software and Hardware compatibility	15
What's new in this release	15
Improvement	16
Bug Fix	16
Known Issues	16
Release 3.5.0-r0_a2	17
Software and Hardware compatibility	17
What's new in this release	17
Known Issues	17



Release 3.5.0-r0_a1	17
Software and Hardware compatibility	17
What's new in this release	17
Improvement	18
Bug Fix	18
Known Issues	18
Release 3.4.0-r0_a2	19
Software and Hardware compatibility	19
What's new in this release	19
Improvement	19
Bug Fix	19
Known Issues	20
Release 3.4.0-r0_a1	20
Software and Hardware compatibility	20
What's new in this release	20
Improvement	20
Bug Fix	20
Known Issues	21
Release 3.3.3-r0_a1	21
Software and Hardware compatibility	21
What's new in this release	21
Improvement	21
Bug Fix	21
Known Issues	21
Release 3.3.0-r0_a3	21
Software and Hardware compatibility	21
What's new in this release	22
Improvement	22
Bug Fix	22
Known Issues	22
Release 3.3.0-r0_a2	22
Software and Hardware compatibility	22
What's new in this release	22
Improvement	22



Bug Fix	22
Known Issues	23
Release 3.3.0-r0_a1	23
Software and Hardware compatibility	23
What's new in this release	23
Improvement.....	23
Bug Fix	23
Known Issues	24
Release 3.2.1-r0_a1	24
Software and Hardware compatibility	24
What's new in this release	24
Bug fix/Improvement.....	24
Known Issues	24
Release 3.2.1-r0_a0.....	24
Software and Hardware compatibility	24
What's new in this release	25
Bug fix/Improvement.....	25
Known Issues	25
Release 3.1.1	25
Software and Hardware compatibility	25
What's new in this release	26
Bug fix/Improvement.....	26
Known Issues	26
Release 3.1.1	26
Software and Hardware compatibility	26
What's new in this release	26
Bug fix/Improvement.....	26
Known Issues	26
Release 3.1.0	27
Software and Hardware compatibility	27
What's new in this release	27
Bug fix/Improvement.....	27
Known Issues	27
Release 3.0.1	27



Software and Hardware compatibility	27
What's new in this release	28
Bug fix/Improvement.....	28
Known Issues	28
Release 3.0.0	28
Software and Hardware compatibility	28
What's new in this release	28
Bug fix/Improvement.....	29
Known Issues	29
Release 1.2.0	29
Software and Hardware compatibility	29
What's new in this release	29
Bug fix/Improvement.....	30
Known Issues	30
Release 1.1.0	30
Software and Hardware compatibility	31
What's New in this release.....	31
Technical Assistance.....	32



General Information

About this Document

This document provides OneAdvisor 800 firmware version numbers, a description of new features, and a list of unresolved issues associated with this release, unless otherwise specified.

Installation Instructions

- Visit the website below to download the latest firmware. Firmware file has *.exe extension which is self-extractable file.
<http://ona-800.updatemyunit.net>
- Attached a USB memory device into your computer of at least 1GHz of space available (maximum USB capacity is 32B, and formatted as FAT32)
- Run the downloaded firmware file and when prompted select the drive that corresponds to the USB memory device. When completed all the firmware source files will be extracted in the USB root under a folder name “ale”.

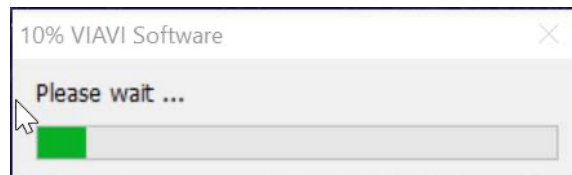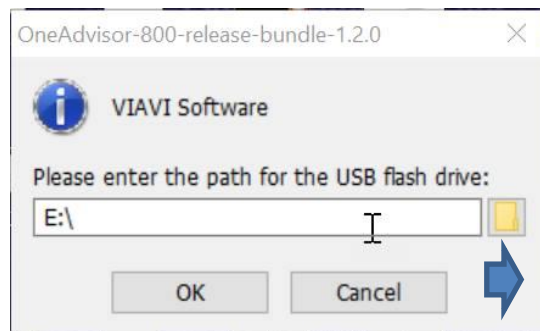

- Connect AC/DC power adapter into the OneAdvisor 800
- Insert the USB memory device into the USB port located on the top of the OneAdvisor 800.
- In OneAdvisor 800 Home Page select: {System}, {Upgrade}, {USB}, {Start Upgrade}:



- The upgrade progress will start and might take 10 minutes to 30 minutes. At the end of the upgrade process the OneAdvisor 800 will reboot to complete the upgrade.
- For more information, refer to OneAdvisor 800 User`s Guide.



Release 4.2.1-r0_a1

Release date: May 11, 2023

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor 800 Wireless.

Hardware	Version	Build
Mainframe	4.2.1	11 May 2023
CAA	6.067.001r	08 May 2023
Fiber Optics	23.22+svn78878	08 May 2023
Radio Analysis	2.400.0005r	08 May 2023
RF Power Meter	7.025.001r	08 May 2023
Transport	4.1.0	08 May 2023

Bug Fix

- Fixed issue with platform SCPI commands

Release 4.2.0-r0_a1

Release date: May 8, 2023

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor 800 Wireless.

Hardware	Version	Build
Mainframe	4.2.0	08 May 2023
CAA	6.067.001r	08 May 2023
Fiber Optics	23.22+svn78878	08 May 2023
Radio Analysis	2.400.0005r	08 May 2023
RF Power Meter	7.025.001r	08 May 2023
Transport	4.1.0	08 May 2023

Please note that upgrading to v4.1.0 will take more time if the current version is 3.x.x. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release.

- RF Test Functions
 - GSM/GPRS/EDGE Signal Analyzer (Perpetual/Floating/Timed options):
 - ONA-SP-GSMOTA: GSM over-the-air analysis
 - ONA-SP-GSMSIA: GSM signal analysis
 - Cable and Antenna Analysis (CAA) implemented in new Test Process Automation (Job Manager)
 - Ability to import cell site location data-base into Interference Advisor (EagleEye).



Improvement

- Transport Test Functions
 - New test measurement tab (Radio Analysis Transport) in Home page.
 - Ability to set multiple streams in Ethernet testing.
 - Additional VSWR testing in ODU-Emulation (SPA06MA module)
- RF Test Functions
 - OneCheck improvements:
 - Allows multiple test selectors.
 - Enables configurable test setting.
 - Allows to post OneCheck files into Favorite's page.
 - Allows deployment of OneCheck files via StrataSync
 - Allows the ability to add help resources (pdf files and/or YouTube video links)
 - EMF Analyzer improvements:
 - Adds limit line to EMF NR Analyzer bar chart.
 - Adds the ability to save test result as CSV, logging as CSV in EMF scanner.
 - Adds the ability to set Amp/Scale units as percentage in EMF scanner.
 - Allows to set specific synchronization and timing metrics in Freq/Time/Power variation measurement tests, of LTE and 5G Analyzer measurement modes.
 - Automatic RF test port selection in RA32MA-O and RA44MA-O between Type-N and Type-K.
 - Recategorize Home page screen.
 - Ability to configure carrier name in NSA analyzer measurement mode.
 - Adds the ability to save results as CSV in Blind scanner.
 - Improves RFoCPRI measurement speed.
 - Removes automatic timestamps in file naming regardless of the file type.
 - Improves SIB1 decoding for TAGS/PLMN/5G NR.
 - Availability of Floating and Timed measurement options
 - Cable and Antenna Analysis (CAA) implementation in new Job Manager.

Bug Fix

- Radio Analysis Application
 - Fixed an issue in DTF measurement that incorrectly set units in foot.
 - Fixed an issue when uploading saved images not successful and marker menu being disabled.
 - Fixed an issue that displays an incorrect Max-Hold value after selecting Trace Write/Min/Max
 - Fixed an issue in Channel Scanner / Route Map, where logging results were not correctly saved as CSV file.
 - Fixed an issue in Channel Scanner / Route Map, where the Attenuation and Preamp were not properly changing.
- Platform
 - Fixed issues with formatting and option import when non-English display languages are selected.

Known Issues

- Infrequent dark screen issue when turned on that needs to reboot the instrument.



- When creating a Favorite file, any space in the icon name makes the Favorite unusable after rebooting.

Release 4.1.2-r0_a2

Release date: Mar 22, 2023

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor 800 Wireless.

Hardware	Version	Build
Mainframe	4.1.2	01 Mar 2023
CAA	6.066.003r	02 Mar 2023
Fiber Optics	23.08+svn78059	02 Mar 2023
Radio Analysis	2.300.0007r	22 Mar 2023
RF Power Meter	7.024.001r	02 Mar 2023
Transport	4.0.1.a235375b440	02 Mar 2023

Please note that upgrading to v4.1.0 will take more time if the current version is 3.x.x. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release.

Improvement

Bug Fix

- Radio Analysis Application
 - RFoCPRI application launching issue.

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling
- When creating Favorite, any space in the name makes the favorite unusable after rebooting.



Previous Version History

This section provides history of previous firmware versions.

Release 4.1.2-r0_a1

Release date: Mar 03, 2023

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor 800 Wireless.

Hardware	Version	Build
Mainframe	4.1.2	01 Mar 2023
CAA	6.066.003r	02 Mar 2023
Fiber Optics	23.08+svn78059	02 Mar 2023
Radio Analysis	2.300.0006r	02 Mar 2023
RF Power Meter	7.024.001r	02 Mar 2023
Transport	4.0.1.a235375b440	02 Mar 2023

Please note that upgrading to v4.1.0 will take more time if the current version is 3.x.x. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release.

Improvement

Bug Fix

- Radio Analysis Application
 - RAN Analyzer: TAGS – sync issues, Check Periodicity
 - MIB decoding prevented normal operation of LTE OTA Channel Scanner

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling
- When creating Favorite, any space in the name makes the favorite unusable after rebooting.

Release 4.1.0-r0_a2

Release date: Dec 21, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor 800 Wireless.



Hardware	Version	Build
Mainframe	4.1.0	14 Dec 2022
CAA	6.066.001r	20 Dec 2022
Fiber Optics	23.00+svn76974	20 Dec 2022
Radio Analysis	2.300.0003r	20 Dec 2022
RF Power Meter	7.024.001r	20 Dec 2022
Transport	4.0.1.34d465f80f9	21 Dec 2022

Please note that upgrading to v4.1.0 will take more time if the current version is 3.x.x. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release

- Mainframe
 - Timing Expansion Module (TEM2) as a reference for Radio Analysis RA Applications
- Transport Test Functions
 - 100GE Ethernet Test capability
- RF Test Functions
 - 9 GHz Radio Analysis module
 - OneCheck workflow automation
 - 5G RAN Analyzer option: 5G NR Beam Analyzer, RTSA, TAGS
 - Dual Band GNSS in Radio Analysis module Applications
 - OneViewer: Post Analysis PC Application for Spectrum and Realtime Spectrum replay and management
 - Floating and Timed license for RF and Transport options

Improvement

- Mainframe
 - Faster bootup time
- Transport Test Functions
 - Internal GNSS reference for PTP/1588
- RF Test Functions
 - Cable Delay standalone measurements with CAA module
 - GNSS sky view in Radio Analysis Applications
 - Convenient switch view between Spectrum and Spectrogram
 - On-Line Route Map for SA, IA, RTSA, TAGS, Channel Scanner
 - PCI Dominance in route-map
 - Improvements on auto-gated sweep setting
 - 5G NR PRB Allocation Map with Utilization and Channel Power
 - Addition of limit lines on Frequency Time and Power Variation
 - Addition of limits on 5G Beam Analyzer metrics (Power, Time Error, and EVM)
 - Interference Advisor improvement with 5G SSB Auto Search & SIB1 Search
 - Allow to overwrite names when saving a file
 - Displays the number of files and selected file in File Manager
 - Warning pop-up window when saving a Result/Report with calibration off



Bug Fix

- Radio Analysis Application
 - Intermittent external half-size modules recognition failure

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling
- When creating Favorite, any space in the name makes the favorite unusable after rebooting.

Release 4.0.2-r0_a3

Release date: Sep 23, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	4.0.2-cfa2158f5b	23/09/2022
CAA	6.065.002r-fd2ce7b	23/09/2022
Fiber Optics	22.54+svn75055	23/09/2022
Radio Analysis	2.210.0003r- b938c24	23/09/2022
RF Power Meter	7.023.001r-ec4695e	23/09/2022
Transport	3.2.1.a45477948c6	23/09/2022

Please note that upgrading to v4.0.1 will take more time. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release

Improvement

Bug Fix

- Radio Analysis Module
 - Fix upgrade process for ONA-800 18GHz and 44GHz modules

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 4.0.2-r0_a1

Release date: Sep 20, 2022



Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	4.0.2-cfa2158f5b	20/09/2022
CAA	6.065.002r-fd2ce7b	20/09/2022
Fiber Optics	22.54+svn75055	20/09/2022
Radio Analysis	2.210.0002r-5c51c8c	20/09/2022
RF Power Meter	7.023.001r-ec4695e	20/09/2022
Transport	3.2.1.a45477948c6	20/09/2022

Please note that upgrading to v4.0.1 will take more time. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release

Improvement

Bug Fix

- Mainframe
 - Bluetooth log filling up disk space has been fixed

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 4.0.1-r0_a1

Release date: Sep 16, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	4.0.1-10ba0851b1	15/09/2022
CAA	6.065.002r-fd2ce7b	16/09/2022
Fiber Optics	22.54+svn75055	16/09/2022
Radio Analysis	2.210.0002r-5c51c8c	16/09/2022
RF Power Meter	7.023.001r-ec4695e	16/09/2022
Transport	3.2.1.a45477948c6	16/09/2022

Please note that upgrading to v4.0.1 will take more time. It could be in the order of 45 minutes as this includes an important operating system update.



What's new in this release

Improvement

Bug Fix

- Mainframe
 - Upgrade issue from previous firmware versions, v3.5 or below, and upgrade from v4.0 beta to another has been fixed
- RF Test Functions
 - Intermittent deactivation of carrier setting menu in 5G NR Carrier Scanner
 - SSB Auto Search is disabled in Freq/Time/Power Variation

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 4.0.0-r0_a1

Release date: Aug 25, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	4.0.0-2bcb4a2bcb	27/08/2022
CAA	6.065.002r-fd2ce7b	27/08/2022
Fiber Optics	22.54+svn75055	27/08/2022
Radio Analysis	2.200.0002r-dca28d8	27/08/2022
RF Power Meter	7.023.001r-ec4695e	27/08/2022
Transport	3.2.0.da66d953cc6	27/08/2022

Please note that upgrading to v4.0.0 will take more time. It could be in the order of 45 minutes as this includes an important operating system update.

What's new in this release

- Mainframe
 - SmartAccessAnywhere with IP address
- RF Test Functions
 - Online Route Map (ONA-SP-ORM)
- Transport Test Functions
 - Transport options for RA18G/32G/44G
 - ONA-SP-10GLAN
 - 10G Ethernet Test
 - ONA-SP-25GE
 - 25G Ethernet Test
 - ONA-SP-10G1588
 - 10GE 1588/PTP Test Option
 - ONA-SP-25G1588



- 25GE 1588/PTP Test Option
- ONA-SP-10GECAP
- 10GigE Packet Capture
- ONA-SP-25GECAP
- 25GigE Packet Capture
- ONA-SP-10M1GE
- 10/100/100 Megabit Ethernet
- ONA-SP-1GECAP
- 1GigE Packet Capture
- ONA-SP-CPRI18L2
- CPRI BERT Line Rate 1 to 8

Improvement

- RF Test Functions
 - 110 MHz Bandwidth for Real-Time Spectrum Analysis
 - Number of user definable trace point
 - Independent detector per trace
 - DAS Solutions: LTE demodulation w/o PSS/SSS and Channel Scanner Route Map
 - Temporary backup for Route Map data
 - LTE PDSCH Precoding & MIB Decoding
 - EMF-NR Analysis
 - PDSCH Mapper
 - TAGS Phase-2 (LTE-TDD, NR TDD Pattern-2)
 - TAGS Interface with InterferenceAdvisor
 - RFoCPRI usability improvement for speed and accuracy improvement
 - IF Overload vs. Auto Preamp
 - Report Generator

Bug Fix

- RF Test Functions
 - RFoCPRI Spectrum to Spectrogram change takes 27 seconds
 - Event Save – Save on Event freezes the trace once an event is happened. And the spectrum trace is not saved.
 - Noise Marker did not support linear scale unit.
 - Improved correlation between SS-RSRP and PBCH DMRS RSRP in 5G NR
 - Internal Power Meter: External offset does not work as defined in the user manual
 - Frequency setting overflow in Freq/Time/Power Variation
 - Trigger/Frequency reference menu is missing in IA Spectrogram
 - LTE selection is deactivated in GATED Sweep

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling



Release 3.5.0-r0_a2

Release date: July 28, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.5.0-66c7bd6	25/04/2022
CAA	6.064.003r-efb20b5	22/07/2022
Fiber Optics	22.20+svn73572-r0	22/07/2022
Radio Analysis	2.100.0014r-bc5e11d	22/07/2022
RF Power Meter	7.022.001r-bc8f4ca	22/07/2022
Transport	3.1.0 637018d	22/07/2022

What's new in this release

- Support new digital board (>rev 007) in RA18MA-O, RA32MA-O, and RA44MA-O

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.5.0-r0_a1

Release date: Apr 28, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.5.0-66c7bd6	25/04/2022
CAA06MA/CAA06MB	6.064.001r-834cc1f	29/04/2022
Fiber Optic	22.20+svn73572-r0	29/04/2022
SPA06	2.100.0009r-6d592ca	29/04/2022
RFPM	7.022.001r-bc8f4ca 29/04/2022	29/04/2022
Transport	3.1.0.637018d 29/04/2022	29/04/2022

What's new in this release

- RF Test Functions
 - Scanner (Spectrum centric) (Option: ONA-SP-CHS)
 - DSS Signal Analysis (Option: ONA-SP-DSSSIA)
 - Support RA18G/32G/44G Solution module
 - EagleEye Interface with RA18G/32G/44G Solution module
 - Blind Scan supports PLMN decoding for LTE



- 5G NR Carrier Scanner supports PLMN decoding for 5G NR SA mode
- Transport Test Functions
 - 10GigE Packet Capture (Option: ONA-SP-10GECAP)
 - 10/100/1000 Megabit and 1 Gigabit Ethernet LAN (Option: ONA-SP-10M1GE)
 - 1GigE Packet Capture (Option: ONA-SP-1GECAP)
 - 25GE 1588/PTP Test Option (Option: ONA-SP-25G1588)
 - 25GigE Packet Capture (Option: ONA-SP-25GECAP)
 - CPRI Layer 2 NERT Rates 1 to 8 (Option: ONA-SP-CPRI18L2)

Improvement

- RF Test Functions
 - Usability improvement for TAGS: Manual setting and Gate Window setting GUI
 - Auto File Name
 - Auto CPRI configuration
 - Supports latest Nokia format and legacy Ericsson format
 - Support one button report generation for interference/PIM.
 - Supports P vs. T (Slot) in LTE/5G NR SiA
 - One button ClearWrite/Max/Min Trace set
 - Improvement for Auto Preamp for smooth noise floor variation
 - Adjustable Column width in Load window
 - Cell Phase Sync chart range: +/- 4.5 ms
 - Time Error Window: SSB Periodicity (5/10/20/40/80/160 ms), Frame (10 ms), Half Frame (5 ms)
- Transport Test Functions
 - Able to connect with multiple O-RUs with the M-plane

Bug Fix

- RF Test Functions
 - RFoCPRI Auto Configuration – fix bug on Save and Load Setup
 - RFoCPRI RX Setting supports 4x Carriers up to 8xMIMO
 - RFoCPRI RSSI/Slop calculation
 - Error in updating time chart in OTA Channel Scanner
 - Internal Power Meter – 5MHz BW
 - External Power Meter – Wrong Frequency setting
 - Freq/Time/Power Variation – Auto Scale
 - Freq/Time/Power Variation – forcing PCI Manual
- CAA Test Functions
 - Fixed an issue that displays no parameter setup menus for RF Source in the full Measure Setup screen

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling



Release 3.4.0-r0_a2

Release date: Jan 28, 2022

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.4.0	19 Dec 2021
SPA06MA/SPA06MA-O	2.000.0008r	26 Jan 2022
Transport	3.0.0.fb4e563	21 Dec 2021
CAA06MA/CAA06MB	6.063.002r	26 Jan 2022
Fiber Optic	22.00+svn71660	26 Jan 2022
RFPM	7.021.001r	21 Dec 2021

What's new in this release

- TDD Auto Gated Spectrum for 5G TDD (Option: ONA-SP-TAGS)
- Cell Phase Sync Analysis for 5G NR (Option: ONA-SP-CPS)
- 10GE 1588/PTP Test Option (Option: ONA-SP-10G1588)
- ODU C-Plane Emulation (Option: ONA-SP-ODUC)
- RFoCPRI Auto Configuration
- Support MA OTDR module
- Support TEM2

Improvement

- Management of different extremities
- Sweep time Max= 600s
- Gated Sweep: Zero Span trace can be synchronized with GPS
- Auto File Naming for CAA Module
- Blind Scan performance improvement (5G NR & DSS)
- Antenna Editor for EMF
- Added more Guidelines in the Standard
- CPRI frame capture
- Reduce the power offset across the mode in LTE
- More precise control in Auto Preamp

Bug Fix

- INCIRP line display in full span
- PIM flatness calculation
- Spectrum Route Map. Min logging time is changed from 20 min to 2 hrs.
- Error on DSS detection
- Sync module tab with actual module assembly status
- Fixed Y-scale error on 5G NR Carrier Scanner – Time Error
- RFoCPRI Auto Configuration clears up previous setting/findings before starting new search
- Fixed discontinued noise floor on Band 3 and Band 5 in SA and RTSA
- Fixed error in license info sharing when connected with EagleEye.



Known Issues

Infrequent dark screen issue when turned on that needs power recycling

Release 3.4.0-r0_a1

Release date: Dec 22, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.4.0	20 Dec 2021
SPA06MA/SPA06MA-O	2.000.0004r	22 Dec 2021
Transport	3.0.0.fb4e563	22 Dec 2021
CAA06MA/CAA06MB	6.063.001r	22 Dec 2021
Fiber Optic	21.64+svn70899	22 Dec 2021
RFPM	7.021.001r	22 Dec 2021

What's new in this release

- TDD Auto Gated Spectrum for 5G TDD (Option: ONA-SP-TAGS)
- Cell Phase Sync Analysis for 5G NR (Option: ONA-SP-CPS)
- 10GE 1588/PTP Test Option (Option: ONA-SP-10G1588)
- ODU C-Plane Emulation (Option: ONA-SP-ODUC)
- RFoCPRI Auto Configuration
- Support MA OTDR module
- Support TEM2

Improvement

- Management of different extremities
- Sweep time Max= 600s
- Gated Sweep: Zero Span trace can be synchronized with GPS
- Auto File Naming for CAA Module
- Blind Scan performance improvement (5G NR & DSS)
- Antenna Editor for EMF
- Added more Guidelines in the Standard
- CPRI frame capture
- Reduce the power offset across the mode in LTE
- More precise control in Auto Preamp

Bug Fix

- INCIRP line display in full span
- PIM flatness calculation
- Spectrum Route Map. Min logging time is changed from 20 min to 2 hrs.
- Error on DSS detection



Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.3.3-r0_a1

Release date: Dec 14, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.3.0	3.3.3-r0 (08/12/2021)
SPA06MA/SPA06MA-O	1.900	1.9000.0004r_d71c478 (27/11/2021)
Transport	2.2.3	2.2.3.fff6f1c-1 (27/11/2021)
CAA06MA/CAA06MB	6.062	6.062.003r-1 (22/11/2021)
Fiber Optic	21.62	21.62+svn70611-r0 (26/11/2021)

What's new in this release

Improvement

- Minor Change
- CPME

Bug Fix

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.3.0-r0_a3

Release date: Dec 1, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor-800.

Hardware	Version	Build
Mainframe	3.3.0	3.3.0-r0 (18/08/2021)
SPA06MA/SPA06MA-O	1.900	1.9000.0004r_90748bd (18/08/2021)
Transport	2.2.0	2.2.0.52d1710-1 (18/08/2021)
CAA06MA/CAA06MB	6.062	6.062.001r-1 (16/08/2021)
Fiber Optic	21.62	2021/11/26



What's new in this release

- EONAOTDRMA-ATT
- EONAOTDRMA-ATT-UPG

Improvement

- SDK changes for piranha2.5 (MSI and pci stuff)
- New OTDR rpm for piranha2.5 support
- TrueBIDIR function can now be activated on any 4100 series B & C OTDR modules
- Compatibility with MA OTDR Hi

Bug Fix

- TrueBIDIR now works when directory name contains space

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.3.0-r0_a2

Release date: Jun 25, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.3.0	3.3.0-r0 (18/08/2021)
SPA06MA/SPA06MA-O	1.900	1.9000.0004r_90748bd (18/08/2021)
Transport	2.2.0	2.2.0.52d1710-1 (18/08/2021)
CAA06MA/CAA06MB	6.062	6.062.001r-1 (16/08/2021)
Fiber Optic	21.50	21.50+svn69930-r0 (08/10/2021)

What's new in this release

- Supports new OSA module for ONA-800 mainframe
- New OSA user interface
- Add 25GHz channel grid for DWDM OTDR application

Improvement

- Better management of 3-splitter clusters in PON architecture with FTTH-SLM
- Optimized OTDR test time vs. pulse width in high split ratio (>1x64)

Bug Fix

- The launch cable integrated into the OTDR module is correctly managed
- Average loss value different between pdf report and SLM



Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.3.0-r0_a1

Release date: Jun 25, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAMI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.3.0	3.3.0-r0 (16/07/2021)
SPA06MA-O	1.900	1.9000.0001a_67 (10/08/2021)
Transport	2.2.0	2.2.0 (13/08/2021)
CAA06MA/CAA06MB	6.062	6.062.001r-1 (09/08/2021)
Fiber Optic	21.12	21.12+svn68387-r0 (25/06/2021)

What's new in this release

- Support for Spectrum Clearing in InterferenceAdvisor EagleEye
- 10G Ethernet (ONA-SP-10GELAN)
- 25G Ethernet (ONA-SP-25GE)
- ODU Emulation S-plane (ONA-SP-ODUS)
- ODU Emulation M-plane (ONA-SP-ODUM)
- Supports VMF/PL (ONA-PMVFL)

Improvement

- Blind Scan: Usability Improvement by populating pop-up to allow user to pick up measurement to run in conjunction with detected carriers
- Ericsson RFoCPRI 9/1 mapping: Able to extract exponent value loaded on the payload and ensure the validity of UL spectrum level
- RFoCPRI PIM – Spectrum flatness: Display RSSI and spectrum flatness of 4XMIMO Antenna
- Multi PCI dynamic range (NR & LTE)
- EMF Analyzer: Scanner: EMF Analyzer supports spectrum centric EMF measurement for multiple discrete bands sequentially and automatically.
- Auto Preamp: Auto Preamp and Input Atten control in IA& SA mode
- RF Power meter: Support external RF Power Sensor
- Custom favorites: User can create Favorite on the system screen with current setting or setup file
- LTE-FDD/TDD supports Subframe measurement
- Support Trace function in 5G NR EIRP measurement

Bug Fix

- RFoCPRI: CPRI configuration is disabled for WCDMA
- LTE-OTA Control: Negative EVM value shouldn't be displayed
- RFoCPRI Load Setup is not working



- SFP decode errors on the ONA-800
- Spectrum Route Map: PEAK frequency is not updated properly

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.2.1-r0_a1

Release date: Jun 25, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.2.1	3.2.1-r0 (04/05/2021)
SPA06MA-O	1.800	1.8000.0002r-a5adfd1 (25/06/2021)
CAA06MA/CAA06MB	6.061	6.061.001r-1 (21/06/2021)
Fiber Optic	21.12	21.12+svn68387-r0 (25/06/2021)

What's new in this release

- Supports Nano-OSA
- Supports PM/VFL

Bug fix/Improvement

- Improved Spectrum sweep time in Normal mode and Gated Sweep. It is about four times faster typically.
- Fixed error on RFoCPRI NEM default Setting
- Fixed error in applying color on Route Map when recalling GOMV files
- Fixed bug retaining watermark on thumbnail map
- Added AVG on Zero Span Trace in Gated Sweep
- Fixed Zero span trace level error due to Channel No change.
- Fixed Gate Length setting error in Gated Sweep

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.2.1-r0_a0

Release date: May 6, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
----------	---------	-------



Mainframe	3.2.1	3.2.1-r0 (04/05/2021)
SPA06MA-O	1.700	1.7000.0009r-b77eff8 (28/04/2021)
CAA06MA/CAA06MB	6.060	6.060.001r-1 (28/04/2021)
Fiber Optic	21.02	21.04+svn67715-r0 (29/04/2021)

What's new in this release

- NSA Analyzer
- Scalar 2 Port
- LTE FDD/TDD Signal Analysis
 - Constellation, Frame Summary, Data Allocation Map, P vs. T (Frame)
- 5G NR Signal Analysis
 - P vs. T (Frame)
- Blind Scanner for LTE, DSS, and NR carrier search

Bug fix/Improvement

- RFoCPRI speed improvement in Quad SA mode
- RFoCPRI usability improvement for easier RX settings and traces control.
- Feature improvement on LTE FDD/TDD OTA Analyzer
 - Occupied BW, SEM, ACLR, Multi-ACLR, OTA Control Channel
- Feature improvement on 5G NR OTA Analyzer
 - Occupied BW, SEM, ACLR, Multi-ACLR, Multipath Profile
- EMF Analyzer
 - Improve beam visibility
 - RSRP Max/Min/AVG
 - Level Recorder for EMF-NR
 - Add UL/DL Allocation factor in EMF-NR Extrapolation
 - Append Standard guidelines
 - Export to CSV for EMF-NE
- NR/DSS improvement
 - PBCH-DMRS Power/EVM
 - Auto preamp control in LTE
 - NSA/DSS logging file export to Google Earth/Map
- Added Band 87 and 88 in the Channel Std

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.1.1

Release date: Feb 12, 2021

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
----------	---------	-------



Mainframe	3.1.1	3.1.1-r0 (12/22/2020)
SPA06MA-O	1.600	1.600.0007r-19bd4f3 (12/23/2020)
CAA06MA/CAA06MB	6.040	6.040.002r-1 (12/17/2020)
Fiber Optic	19.92	19.92+svn65461-r3 (12/11/2020)

What's new in this release

- Supports SPA06MA module, a new 6GHz spectrum only hardware
- Sync of Preamp and Attenuation settings between ONA-800A and InterferenceAdvisor, EagleEye App

Bug fix/Improvement

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.1.1

Release date: Dec 24, 2020

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.1.1	3.1.1-r0 (12/22/2020)
SPA06MA/SPA06MA-O	1.600	1.600.0007r-19bd4f3 (12/23/2020)
CAA06MA/B	6.040	6.040.002r-1 (12/17/2020)
Fiber Optic	19.92	19.92+svn65461-r3 (12/11/2020)

What's new in this release

- **Spectrum/CPRI software options (Requires SPA06MA-O hardware)**
 - N/A
- **Fiber/Optic solution modules supported**
 - N/A
- **Fiber/Optic software option**
 - N/A

Bug fix/Improvement

- Fixed display flickering issue

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling



Release 3.1.0

Release date: Dec 18, 2020

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.1.0	3.0.1-r0 (11/12/2020)
SPA06MA-O	1.600	1.600.0006r-0653b3a (14/21/2020)
CAA06MA/CAA06MB	6.040	6.040.002r-1 (17/12/2020)
Fiber Optic	19.92	19.92+svn65461-r3 (11/12/2020)

What's new in this release

- **Spectrum/CPRI software options (Requires SPA06MA-O hardware)**
 - ONA-SP-DSSOTA; DSS OTA Analyzer
 - RtSA improvement. Narrower span for better resolution and smaller RBW for better sensitivity.
 - Span: 100MHz to 3Mhz
 - RBW: 10MHz to 3kHz
- **Fiber/Optic solution modules supported**
 - N/A
- **Fiber/Optic software option**
 - N/A

Bug fix/Improvement

- Make CDM file generation configurable.
- Fixed LTE-FDDOTA, LTE-TDDOTA, DSSOTA license installation issue
- Change the warning message for Factory Reset
- Fixed invalid error message displaying after turned on

Known Issues

- Infrequent dark screen issue when turned on that needs power recycling

Release 3.0.1

Release date: Oct 20, 2020

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.0.1	3.0.1-078fabd (14/10/2020)
SPA06MA-O	1.400	1.400.0027r-6bcfb31 (21/10/2020)
CAA06MA/CAA06MB	6.020	6.020.001r-1 (21/10/2020)
Fiber Optic	19.90	19.90+svn65054-r0 (15/10/2020)



What's new in this release

- **Spectrum/CPRI software options (Requires SPA06MA-O hardware)**
 - ONA-SP-5GOTA; 5GNR OTA Beamforming analyzer
 - ONA-SP-EMFSA; EMF Analysis (Spectrum Analysis base)
 - ONS-SP-EMFNR; EMF Analysis (NR Beam Analysis base)
- **Fiber/Optic solution modules supported**
 - E4123MM; Multimode 850/1300 nm OTDR Module
 - E4138FMA365-APC; METRO-ACCESS/PON 1310/1550//F1650 NM APC OTDR MODULE
 - E4146QUAD; Multimode / Single mode 850/1300/1310/1550 nm OTDR PC
 - E4146QUAD; Multimode / Single mode 850/1300/1310/1550 nm OTDR APC
 - E41OTDRPM; Power Meter Option for OTDR Modules
- **Fiber/Optic software option**
 - EFTTHSLM; FTTH-SLM OTDR FUNCTION
 - EFTTHSLM-UPG; FTTH-SLM OTDR UPG OPTION
 - EFTTASLM; FTTA-SLM FUNCTION
 - EFTTASLM-UPG; FTTA-SLM OTDR UPG OPTION

Bug fix/Improvement

- Fixed bug causing blur at the bottom of the LCD display
- Frequency stability improvement using GPS

Known Issues

Release 3.0.0

Release date: Aug 29, 2020

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	3.0.0	3.0.0.0ec96ca
SPA06MA-O	1.3.0	1.300.1241r-1881b00
CAA06MA/CAA06MB	6.011	6.011.001r-1
Fiber Optic	18.98	18.98+svn64254-r0

What's new in this release

- **TPA (Test Process Automation)**
 - TPA becomes more interactive by offering pop-up window informing user about the next job scheduled and also allowing user can choose whether to continue or do more troubleshooting at the current mode.



- TPA works with Spectrum Analyzer, Interference Analyzer, RtSA, and RFoCPRI measurement
- **Spectrum/CPRI software options (Requires SPA06MA-O hardware)**
- **Fiber/Optic solution modules supported**
 - E41 E4138FMA365-APC
 - E4146QUAD-PC
 - E4146QUAD-APC
 - E4123MM-PC
 - E41OTDRPM
- **Fiber/Optic software option**
 - EFTTHSLM
 - EFTTHSLM-UPG
 - EFTTASLM
 - EFTTASLM-UPG

Bug fix/Improvement

- RF Source of CAA module can work with RadioAnalysis concurrently.
- Reduced FAN noise
- Spectrum freezing with specific frequency setting at the below of 40MHz
- Messing up spectrum trace when Min Hold or Average is used in RFoCPRI

Known Issues

Release 1.2.0

Release date: June 29, 2020

Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for OneAdvisor.

Hardware	Version	Build
Mainframe	1.2.0	1.2.0-79d5204
SPA06MA-O	1.0.0	1.000.1214r-1bd2e41
CAA06MA/CAA06MB	6.010.006r	9b02487
Fiber Optic	18.96	svn63634-r0 (19/06/2020)

What's new in this release

- **Platform**
 - Supports interoperability with VIAVI's AntennaAdvisor Handle



- Supports interoperability with VIAMI's InterferenceAdvisor, an Android based Automated Interference Hunting Solution.
- **Spectrum/CPRI software options (Requires SPA06MA-O hardware)**
 - ONA-SP-GNSS: GPS Option
 - ONA-SP-RT50: Realtime Spectrum Analysis up to 50MHz BW
 - ONA-SP-RT100: Realtime Spectrum Analysis up to 100MHz BW
 - ONA-SP-INTAN: Interference Analyzer (Interference Finder, Radar Chart, AA Handle)
 - ONA-SP-GSS: Gated Sweep Spectrum
 - ONA-SP-RM: Spectrum Route Map
 - ONA-SP-CPRI17: RFoCPRI Interference Analyzer for CPRI link rate from 1 to 7
 - ONA-SP-CPRI8: RFoCPRI Interference Analyzer for CPRI link rate 8
 - ONA-SP-CPRI18: RFoCPRI Interference Analyzer for link rate from 1 to 8
- **Fiber/Optic solution modules supported**
 - E41DWDMC-APC: E41DWDMC-PC; TUNABLE DWDM APC OTDR MODULE – C-BAND
 - E41DWDMC-PC: E41DWDMC-PC; TUNABLE DWDM PC OTDR MODULE – C-BAND
 - 2301/12: 2301/12; COSA-4055 APC CWDM OSA Module with SFP Bay – SC optical adapter mounted FC enclosed
 - 2331/12: 2331/12; OCC-4056C APC; DWDM Analyzer with SFP bay
- **Fiber/Optic software option**
 - 2331/94.01 Tunable SFP for OCC
 - ENTERPRISESLM / ENTERPRISESLM-UPG
 - ESMARTACQ / ESMARTACQ-UPG
 - ECABLESLM / ECABLESLM-UPG

Bug fix/Improvement

- Usability improvement on Home page with test shortcuts and Favorites
- Test Process Automation
 - CAA Check (requires SPA06MA/B module)
 - Job Manager with StrataSync

Known Issues

- N/A

Release 1.1.0

Release date: April 2, 2020 – 1st release



Software and Hardware compatibility

The following table lists the versions of related VIAVI hardware and software that can be used in conjunction with this release for ONA-800A.

Hardware	Version	Build
Mainframe	1.1.0	22/04/2020
CAA06MA/CAA06MB	6.010.003r-1	14/04/2020
Fiber Optic	18.94	17/03/2020

What's New in this release

Solution	Hardware	New SW feature/Option	Brief Description
Base Feature	ONA-800A	ONA-MF-WIFI ONA-MF-BT SAA-ADVISOR	Support of base features on ONA- 800A base including Wi-Fi, Bluetooth, Smart Access Anywhere, Mobile Tech, StrataSync, Job Manager
CAA	CAA06MA/B Module	ONA-CAA-RFS	VSWR, DTF, Cable Loss, Smith Chart, Bias-T, RF Source
OTDR	E4100 series Module	EFTTASLM	SM, MM, QUAD OTDR, LS, PM
FIT	FIT-FC-KIT3		FIT-FC-KIT3; Kit FiberChek Autofocus WiFi Microscope Tips for LC/PC SC/PC and SC/APC Case
OPM	MP-60A		Retrieving data. Wait a few seconds and try to cut or copy again.



Technical Assistance

For assistance related to the use of your product, call or e-mail VIAVI Technical Assistance Center (TAC) in your region. For a current listing of TAC phone numbers and e-mail addresses, go to: <http://www.viavisolutions.com/en/services-and-support/support/technical-assistance>



Viavi Solutions
1-844-GO-VIAVI
www.viavisolutions.com